

REPLACEMENT PARTS LIST - CONTRACT W535-AC-8131

Progress Report Date	Part No.	Part Name and Description	No. of Units	Unit Price	Total
8-15-36	503785	Pin - piston ring Pin for first and second ring became loose in piston 5L, replaced with new part fitting tighter in piston	2	1.14	2.28
8-15-36	503797	Manifold intake. The intake manifold was tight on the rear side of front studs. Stud holes were elongated to provide more clearance for expansion.		No Charge	
8-15-36	503648	Roller - valve rocker Used on cylinder No. 5L picked up on O.D. Replaced with new part, no change	1	2.30	2.30
8-15-36	503801	Pipe intake. Cylinder No. 6R intake pipe was cracked at the flange. Replaced with new part, no change	1	<u>1.58</u>	<u>1.58</u>
Total of Replacement Parts List dated 8-15-36.....					\$6.16

RECAPITULATION

Total of Replacement Parts List dated 6-15-36	\$1,668.73
Total of Replacement Parts List dated 6-30-36	1,703.38
Total of Replacement Parts List dated 7-15-36	0,000.00
Total of Replacement Parts List dated 7-31-36	392.84
Total of Replacement Parts List dated 8-15-36	<u>6.16</u>
Total Government liability to date, 8-15-36, over and above the amount specified in Article 17, as provided for in paragraph #3d, Item 3 of Article 15, subject contract	\$3,771.11

AIR CORPS INSPECTOR'S CERTIFICATE

I certify that the articles listed on page one of this report dated 8-15-36 were inspected and accepted by me in the quantities

stated, and that they conform to the contract requirements for articles and parts used in the subject engine, and that the above replacement articles and parts were necessary for the continued operation of the subject engine.

Silas C. Snyder
Inspector's Signature

Procurement Inspector
U. S. Army Air Corps
Title and Rank

8-21-36
Date